



DDC AD NO.

FUNDING PROJECT NO. 1L161101A91A

TECOM PROJECT (TRMS) 7-CO-IL1-AP1-001

TEST AGENCY REPORT APG-MT-5586

TEST SPONSOR US ARMY TEST AND EVALUATION

COMMAND

TEST SPONSOR PROJECT NO. NOT AVAILABLE

TRADOC A.C. NOT AVAILABLE

FINAL REPORT

ILIR INVESTIGATION


OF


MIXED BRAKE FLUID CORROSION TESTS

BY

CHARLES B. JORDAN

SEPTEMBER 1981






This document has been approved for public release and sale; its distribution is unlimited.

-DISTRIBUTION LIMITED TO US GOVERNMENT AGENCIES ONLY; TEST AND
-EVALUATION; SEPTEMBER 1981. OTHER REQUESTS FOR THIS DOCUMENT
-MUST BE REFERRED TO TECOM; ATTN: DRSTE-AD N WHEN CODE SHEET
-IS INCLUDED.

DISTRIBUTION UNLIMITED WHEN CODE SHEET IS REMOVED.

US ARMY ABERDEEN PROVING GROUND ABERDEEN PROVING GROUND, MARYLAND



REPRODUCTION LIMITATIONS

Reproduction of this document in whole or in part is prohibited

except with the permission of <u>Commander</u>, <u>TECOM</u>, <u>ATTN</u>: <u>DRSTE-AD-M when code sheet is included</u>. <u>Distribution unlimited when code sheet is removed</u>.

DTIC is authorized to reproduce this document for United States Government purposes.

DISPOSITION INSTRUCTIONS

Destroy this report in accordance with appropriate regulations when no longer needed. Do not return it to the originator.

DISCLAIMER

Information and data contained in this document are based on input available at the time of preparation. Because the results may be subject to change, this document should not be construed to represent the official position of the US Army Materiel Development Readiness Command unless so stated.

Unclassified
SECURITY CLASSIFICATION OF THIS PAGE (When Date Entered)

REPORT DOCUMENTATION PAGE	READ INSTRUCTIONS
1. REPORT NUMBER 2. GOVT ACCESSION NO.	BEFORE COMPLETING FORM 3. RECIPIENT'S CATALOG NUMBER
TECOM Project 7-CO-ILI-API-001 AD A 1119	36
4. TITLE (and Substitle) ILIR INVESTIGATION OF MIXED BRAKE FLUID CORROSION	5. TYPE OF REPORT & PERIOD COVERED Final, January to September
TESTS	1981
	6. PERFORMING ORG. REPORT NUMBER APG-MT-5586
7. AUTHOR(a)	8. CONTRACT OR GRANT NUMBER(*)
Charles B. Jordan	None
9. PERFORMING ORGANIZATION NAME AND ADDRESS	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
Materiel Testing Directorate	AREA & WORK UNIT NUMBERS
ATTN: STEAP-MT-G	ILIR Task 001-K202
Aberdeen Proving Ground, MD 21005	
11. CONTROLLING OFFICE NAME AND ADDRESS	12. REPORT DATE
Commander, TECOM	September 1981
ATTN: DRSTE-AD-M	13. NUMBER OF PAGES
Aberdeen Proving Ground, MD 21005	16
14. MONITORING AGENCY NAME & ADDRESS(If different from Controlling Office)	15. SECURITY CLASS. (of this report)
None	
15. DECLASSIFICATION/DOWNGRADING	
	SCHEDULE None
September 1981. Other requests for this document ATTN: DRSTE-AD-M when code sheet is included. Discode sheet is removed. 17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, it different from None	letribution unlimited when
18. SUPPLEMENTARY NOTES Codo shoet attached:	
Brake fluid Silicone Polyglycol Compatibility Corrosion	,
An investigation was conducted to determine the effort of mixing silicone and conventional polyglycol branching tests were conducted in accordance with profilial specifications. It was concluded that there rosion inhibitors between fluids, but excessive comixing the two fluids.	ffect on corrosion properties ake fluid. More than 100 cor- ocedures listed in the brake a is some migration of cor-


DD 1 JAN 73 1473 EDITION OF 1 NOV 85 IS OBSOLETE

Unclassified

TABLE OF CONTENTS

		PAGE
	FOREWORD	1
	SECTION 1. SUMMARY	
PARAGRAPH NUMBER		
1.1	BACKGROUND	3
1.2	OBJECTIVE . ,	3
1.3	SUMMARY OF INVESTIGATION	3
1.4	CONCLUSIONS	3
1.5	RECOMMENDATIONS	4
1.6	INTERPRETATION OF ACCOMPLISHMENTS	4
	SECTION 2. DETAILS OF INVESTIGATION	
2.1	MATERIALS TESTED	5
2.2	CORROSION TESTS	5
2.3	RESULTS	6
2.4	ANALYSIS	7
	SECTION 3. APPENDICES	
A	TABLES	A- 1
В	REFERENCES	B- 1
С	DISTRIBUTION LIST	C- 1

Removal of Code Sheet makes report unlimited per Mr. Charles Jordan, TECOM/DRSTE_AD_M

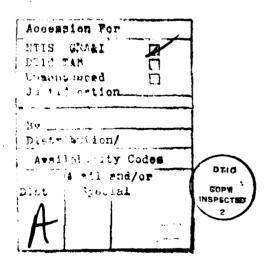

FOREWORD

and the state of t

This work was accomplished under the Army's In-House Laboratory Independent Research (ILIR) Program, TECOM Project No. 7-CO-ILI-API-001, Task 02.

Acknowledgement is extended to Mr. A. O'Brochta and Ms. R. Gibson for their assistance in the accumulation of laboratory data included in this report.

SECTION 1. INTRODUCTION

1.1 BACKGROUND

The US Army initiated research on silicone brake fluids in 1967. Satisfactory completion of a large number of laboratory and field tests (reported in ref 2 and 3) showed that the silicone fluids possessed many desirable physical and chemical properties with respect to power transmission in brake systems. Subsequently, a specification was published (ref 4) which replaced the three existing military brake fluid specifications (ref 5, 6, 7). Cost effectiveness studies showed that replacement of the three conventional brake fluids with a single all purpose fluid would be feasible. This also permitted simplification of logistics.

A retrofit procedure for implementing the use of silicone fluid (ref 8) involves a drain/bleed/fill procedure which often allows the retention of some residual conventional brake fluid in the brake system. Potential corrosion of metal brake components exists due to possible brake fluid corrosion inhibitor incompatibility. In order to resolve this possible area of concern, an in-depth study of corrosion properties of mixtures of silicone and conventional brake fluids was authorized by the Department of the Army's In-House Laboratory Independent Research Program. Results of this study will aid brake system engineers in their evaluation of the performance of the new silicone brake fluids, and establish the viability of the published retrofit procedure.

1.2 OBJECTIVE

The objective of this study was to locate possible problem areas which may arise as a result of mixing silicone and conventional brake fluids.

1.3 SUMMARY OF INVESTIGATION

More than 100 corrosion tests were conducted in accordance with procedures outlined in references 4 and 5, using combinations of four different silicone brake fluids and three representative conventional brake fluids. This report contains the results of all findings included in the study.

1.4 CONCLUSIONS

It is concluded that:

- a. There will be no excessive corrosion of brake systems brought about by mixing silicone brake fluids and polyglycol brake fluids.
- b. Instances of increased staining, slight etching, and weight change were found. These conditions verify that corrosion inhibitor migration sometimes occurs, but the loss in corrosion protection found in this study is not of sufficient magnitude to cause brake failure.
- c. Rubber cups which were included in the test were not adversely affected. There was only a trace of sediment found in two of the test fluids.

1.5 RECOMMENDATIONS

It is recommended that:

- a. The findings of this report be made readily available to members of the vehicle brake industry.
- b. Mixing of fluids be minimized so that corrosion protection will be at the maximum level.

1.6 INTERPRETATION OF ACCOMPLISHMENTS

The data generated in this study substantiates the viability of military changeover from polyglycol brake fluids to silicone brake fluids. All testing accomplished by the Army to date shows conclusively that the advantages of silicone fluids are significant. There appears to be no valid technical reason to believe that silicone brake fluids will not give superior performance in military brake systems.

SECTION 2. DETAILS OF INVESTIGATION

2.1 MATERIALS TESTED

Tests reported herein were conducted on representative silicone and conventional brake fluids listed in table 2-1. Four silicone brake fluids were used representing qualified fluids from three silicone fluid manufacturers plus the SAE silicone compatibility brake fluid (SAE RM-70A). Three conventional fluids were used consisting of two fluids meeting reference 5, and the SAE conventional compatibility fluid (SAE RM 66-03).

TABLE 2-1. FLUIDS TESTED

Fluids	Туре
Code A	Silicone
Code B	Silicone
Code C	Silicone
SAE RM-70A	Silicone
SAE RM 66-03	Conventional
	polyglycol
м9309	Conventional
	polyglycol
Code D	Conventional
	polyglycol

2.2 CORROSION TESTS

- a. Corrosion tests were conducted on each of the conventional polyglycol fluids in accordance with the test procedure specified in reference 5. Corrosion tests were conducted on each silicone fluid in accordance with the test procedure specified in reference 4. Due to the immiscibility of silicone/conventional brake fluids it was necessary to develop a modified test procedure for fluid mixtures which would permit uniform exposure of the metal test specimens to each fluid. This procedure consisted of mixing equal portions of the silicone fluid and the conventional fluid with 5% water added, thoroughly shaking the mixture and placing the mixture in an oven at 100° C for 24 hours. The mixture was then shaken again and poured into a separatory funnel and allowed to separate. The separated layers were placed in separate corrosion jars. The corrosion test was then conducted on both fluids by the specified test procedure.
 - b. The tests which were conducted are itemized in table 2-2.
- c. In each test evidence of corrosion, weight change, pH change, sediment formation, and other pertinent data were recorded. All tests were conducted in triplicate and the average of the three test results are reported herein. A comparison was made of the results received on the individual fluids and the fluids after mixing.

TABLE 2-2. TESTS CONDUCTED

Test		Fluid
A		SAE RM 66-03
В		SAE RM 70A
С		Code A
D		Code B
E		Code C
F		M9309
G		Code D
Mixture No.	1	RM 66-03/RM 70A
Mixture No.	2	RM 66-03/Code A
Mixture No.	3	RM 66-03/Code B
Mixture No.	4	RM 66-03/Code C
Mixture No.	5	M9309/RM 70A
Mixture No.	6	M9309/Code A
Mixture No.	7	M9309/Code C
Mixture No.	8	M9309/Code B
Mixture No.	9	Code D/Code C
Mixture No.	10	Code D/Code B
Mixture No.	11	Code D/Code A
Mixture No.	12	Code D/RM 70A

2.3 RESULTS

Results of all tests conducted in this program are tabulated in appendix A.

- a. Effect on RM 66-03 (conventional). Results of tests on RM 66-03 showed increased staining on nearly every metal, after mixing with silicone fluids. Some etching was evident on the aluminum (1 test), cast iron (1 test), and steel (1 test) test specimens. Staining or etching was not severe in any of the tests. No pitting occurred. Weight losses increased on the brass and copper in some tests but these weight changes were not excessive.
- b. Effect on M9309 (conventional). Only a very slight increase in staining was evident on any of the metals in tests involving mixtures of this fluid and the silicone fluids. Etching of the tin and aluminum was found in mixture No. 6 (M9309/Code A), along with borderline weight loss in the brass and copper. No pitting was evident.
- c. Effect on Code D (conventional). This fluid showed very little change in appearance or weight in any of the tests. The only recordable changes were a slight increase in staining on the brass specimen in two tests and very slight etching of the steel and cast iron mixture No. 9 (Code D/Code C). No pitting occurred.
- d. Effect on RM 70A (silicone). Except for a very slight increase in staining on some of the metals and slight etching of the cast iron in mixture No. 1 (RM 66-03/RM 70A), this fluid was not effected by mixing with conventional fluids. No significant weight changes occurred in any of the metals.

- e. Effect on Code A (silicone). This fluid showed correased starning on several metals after mixing with conventional fluids. The stains were not excessive. The brass specimen in mixture No. 2 (RM 60-03/Code A) appeared to be moderately etched. There was no pitting or significant changes in weight.
- f. Effect on Code B (silicone). Code B fluid showed increased, but not excessive copper staining in all tests involving mixtures of this fluid and conventional fluids. Very slight etching of steel (1 test) and cast iron (1 test) was recorded. No significant weight changes or pitting was observed,
- g. Effect on Code C (silicone). Only a very slight increase in staining, and no etching, no significant weight change, or pitting was noted in any of the tests involving mixtures of Code C with conventional fluids.

2.4 ANALYSIS

- a. In the military changeover from conventional brake fluids to silicone brake fluid, cost effectiveness studies showed that a retrofit procedure consisting of simply draining, bleeding, and filling the brake system was the most practical. Studies have shown that this retrofit procedure will sometimes allow retention of up to 20% residual polyglycol brake fluid in the brake system. A problem exists of potential metal corrosion in systems containing large quantities of residual fluid. Both the polyglycol and the silicone fluids have well balanced corrosion inhibitor systems built into their formulas. The fluids are immiscible when mixed; however, the possibility of migration of additives could occur, which would upset the corrosion inhibitor balance and cause corrosion.
- b. The fluids for inclusion in the present study were selected as being representative of all combinations which would be found in the military vehicles after retrofit. The polyglycol brake fluids consisted of one fluid from stock (M9309), one commercial fluid known to have superior corrosion protection additives (Code D), and the SAE compatibility fluid (RM 66-03). The silicone brake fluids consisted of the three fluids now listed on the QPL for reference 4 and the SAE silicone compatibility fluid (RM 70A). The mixtures which were tested (50/50) should represent the maximum quantity of each fluid which would contribute to additive interchange. The criteria for passing/failing the corrosion tests were established in brake fluid specifications after years of study and, thus, are valid criteria for predicting excessive corrosion resulting from mixing the fluids.
- c. Results of tests conducted show that there will be no excessive corrosion of metals in brake systems caused by mixing silicone brake fluids and polyglycol brake fluids. Instances of increased staining, slight etching, and weight change were found, showing that corrosion inhibitor migration sometimes occurs. The loss in corrosion protection demonstrated in this study, however, will not be sufficient to cause brake failure. There was no adverse effect on the SBR rubber cups which are included in the test. There was only a trace of sediment found in any of the test fluids after test.

SECTION 3. APPENDICES

APPENDIX A - TABLES

TABLE A-1. INDIVIDUAL BRAKE FLUIDS

	Conven	Conventional	Conv	ional	Conventional	ional	Sili	Silicone	Silicone	one		Silicone		ilicone
	Z.	66-03		M9309	Š	le D	Ö U	de A	ğ	le B		le C		A-P
	Weight	Appear-	Weight	Appear-	Weight	Weight Appear-	Weight	Weight Appear-	Weight	Weight Appear-		Appear-	ž.	ight Appear-
Material	Change	Change ance	Change	ance	Change	ance	Change	hange ance	Change	hange ance		ance	뒨	ance
Tin	00.00	o X	+0.02	ŏ	+0.01	οĶ	+0.02	χo	+0.01	OK	0.01	ΘĶ	00.00	S.
Steel		o,	01	VSS	+ .01	SS	+ .02	Š	+ .02	OK	+ .02	OK	+ .01	Š
Aluminum		VSS	003	VSS	+ .02	SS	+ .02	OK	+ .02	OK X	+ .01	Ş	+ .03	ΟĶ
Cast Iron		SS	+ .10	SS	+ .04	SS	+ .03	VSE	+ .05	SS	÷	VSS	+ .07	SS
Brass		SS	60	MS	02	SS	+ .02	88	+ .02	SS	+ :02	SS	10	WS
Copper		SS	14	MS	05	SS	+ .02	SS	+ .01	SS	+ .01	MS	+ .02	MS
pH Before	9.57		10.20		9.61		3.02		3.20		3.30		2.90	
After	8.93		7.41		7.39		5.22		5.09		4.73		4.53	

A-1

VSE = Very slight etching.
VSS = Very slight stain.
SS = Slight stain.
MS = Moderate stain.

TABLE A-2. BRAKE FLUID MIXTURES

		Mixture No.	No. 1			Mixture	Mixture No. 2			Mixture No. 3	No. 3			Mixture No. 4	No. 4			Mixture No. 5	No. 5			Mixture	No. 6	
		_1				RM 6603	- Code A			RM 6603	RM 6603 - Code B			RM 6603	RM 6603 - Code C]	1	M 9309 - F	10A		- 1	- 6016 H	ode A	
Material	We Lght Change	Appear- ance	Change	Appear- ance	Weight Change	Appear- ance	Appear Weight ance Change	Appear- ance	Weight	Appear- ance	Change	Appear- ance	Change	Appear-		Appear- ance	Weight / Change	Appear- ance	hange	Appear- ance	Weight .	Appear- ance	hange	Appear- ance
								1			i I										•	İ		
Tin	0.00	ž	-0.01	š	-0.01	ž	Þ	ž	~0.005	Š	+0.02	ž	+0.003	ð	+0.01	ž	+0.03	VSS	+0.03	ž	+0.01	VSE	+0.03	ř
Steel		SS	+ .02	SS	+ .01	SS	+0,02	SS	900.+	VSE	+ .03	VSE	+ .02	VSS	+ .03	VSS	10	VSS	: 0.	1.55	+ .002	VSS	+ ,02	VSS
Aluminum		SF:	+	SS	02	Æ	- ,02	SS	· · 01	VSS	80. +	š	÷ 00.	МS	9. +	VSS	01	SS	+ .02	VSS	10	<u>4</u>	₹ +	755
Cast Iron		SE	+ .03	SE	+	SS	ð. +	SS	÷.05	VSS	8· +	ž	90. +	SS	8. +	VSS	8.+	VSS	4 .07	VSS	+ .07	SS	· +	1.58
Brass		Ş	+ .01	SS	. 41	SH	· ·	Æ	11	MS	+ .02	SS	60 -	MS.	+ .02	88	90	MS	+ .03	VSS	74	SS	10. +	SS
Copper	1.	S .	10.+	æ	26	SS	+ .01	WS	80.	WS	003	MS	- 05	SS	02	MS.	60	WS	+ .002	¥.	33	VSS	62	MS
a Perfore			8.06		9.62		80.8		9.59		8.25		9.63		8.83		96.6		1.42		3		55	
After	6.86		6.17		7.09		7.14		1.17		7.47		7.83		6.62		7.34		7.59		6.66		8.05	
		Mixture No. 7	, No. 7			Mixtur	Mixture No. 8			Mixture No. 9	No. 9			Mixture No. 10	No. 10			Mixture No. 11	No. 11			Mixture No. 12	No. 12	
		N 9309 -	. Code C			M 9309	- Code B			Code D -	Code		- 1	Code D - Code B	Code B			Code D -	Code A			ode D -	RM 70A	
	Weight	Appear-	Weight	Appear-	Weight	Appear-	Weight	Appear-	Weight	Appear-	Weight	Appear-		Appear-	Weight	Appear~		Appear-		Appear-	Weight /	Appear-	Weight	Appear-
Mater Ial	Change	ance Change	Change	ance	Change	ance	Change	ance	Change	ance	Change	ance	Change	ance	Change	ance	Change	ance	Change	алсе	Change	ance	Change	8DC 6
Iin		ž	+0.03	ž	+0.03	š	÷0.6	š	+0.01	¥	+0.01	ž	+0.01	ŏ	+0.004	ĕ	+0.004	¥	+0.01	ŧ	+0,002	ð	+0.0i	ŧ
Steel			+ .02	¥	+ .01	VSS	+ .03	¥	+ .02	VSE	10.+	ASS	+ .03	VSS	+ .01	vss	+ .03	VSS	+ .03	755	+ .01	7.55	t. 02	VSS
Aluminum	+ .02	VSS	9 8. +	VSS	+ .02	VSS	% +	Š	£. +	vss	+ .02	vss	+ .02	ð	+ . 02	VSS	+ .02	VSS	+ .05	ŧ	+ .03	1.55	÷ .05	Š
Cast Iron			90. +	VSS	89. +	VSS	80° +	VSS	\$. +	VSE	4 .07	vss	÷.05	vss	75. +	VSE	+ .05	VSS	+ .05	VSE	+ .05	VSS	4	VSS
Brass			+ .02	SS	0	MS	+ .05	SS	+ .02	W.	٠.04	SS	+ .02	MS	07	SS	12	SS	+ .03	25	- 09	S S	÷ .03	SS
Copper			+ .02	Ş.	- 00	SF:	003	MS	10. +	SS	03	W.S	. 01	SS	8.	MS.	07	SS	+ .01	ЖS	03	SS	002	S.
on Before	10.25		8.65		10.10		8.85		9.66		7.00		9.58		8.39		9.33		6.76		9.4.6		7.63	
After 7.13	7.13		8.17		3.66		7.34		8.04		8.88		7.24		7.76		7.98		6.47		8.14		6.55	
;	:																							

VSE = Very slight etching.
SE = Slight etching.
SS = Slight stain.
VSS = Very slight stain.
NS = Moderate stain.
ME = Moderate etching.

APPENDIX B - REFERENCES

- 1. Authority: TECOM Task No. 7-CO-ILI-API-001, Agency Accession No. DA ON 1499, ILIR Work Unit 001 K2 02.
- 2. MERDC Report No. 2137, Silicone Brake Fluids: One Year Field Test, February 1975 (AD AO 12849).
- 3. MERADCOM Report No. 2164, Silicone Brake Fluids: Two Year Field Test, January 1976 (AD OZ 6180).
- 4. Military Specification, MIL-B-46176, Brake Fluid Silicone, Automotive, All-Weather, Operational and Preservative.
- 5. Federal Specification, VV-B-680, Brake Fluid Automotive.
- 6. Military Specification, MIL-H-13910, Hydraulic Fluid, Polar Type, Automotive Brake, All Weather.
- 7. Military Specification, MIL-P-46046, Preservative Fluid, Automotive Brake System and Components.
- 8. Technical Bulletin TB 43-0002-87, April 1981, Brake Fluid Silicone Conversion of Tank Automotive Equipment.

APPENDIX C - DISTRIBUTION LIST

TECOM Project No. 7-CO-IL1-AP1-001

Addressee	Final Report
Commander US Army Test and Evaluation Command ATTN: DRSTE-AD-M DRSTE-CM-R Aberdeen Proving Ground, MD 21005	1
Commander US Army Materiel Development and Readiness Command ATTN: DRCO-DC DRCMM-MS 5001 Eisenhower Avenue Alexandria, VA 22333	1 1
Commander US Army Troop Support and Aviation Materiel Readiness Command ATTN: DRSTS-KTE 4300 Goodfellow Boulevard ST Louis, MO 63120	1
Commander Yuma Proving Ground ATTN: Technical Library Yuma, AZ 85364	1
Commander US Army Tank-Automotive Command ATTN: DRSTA-W DRSTA-BMT DRSTA-M DRSTA-G Warren, MI 48090	1 1 1
Commander US Army Cold Regions Test Center ATTN: STEAC-PL-TSA APO Seattle 98733	1
Commander US Army Mobility Equipment Research and Development Command ATTN: DRDME-GL	5

Addressee	Final Report
Commander US Army Tropic Test Center ATTN: STETC-TD-P APO Miami, Florida 34004	1
Commander Naval Air Development Center Code 30212 Warminster, PA 18974	1
HQDA (DAMA-ARZ-DO) HQDA (DAEN-RDLO) Washington, DC 20314	1
HQDA, ODCSLOG Directorate for Transportation and Services Army Energy Office Room 1D570 Washington, DC 20310	1
President US Army Armor and Engineer Board ATTN: ATZK-AE-TD-E Fort Knox, KY 40121	1
Director, Technical Information Defense Advanced Research Projects Agency 1400 Wilson Boulevard Arlington, VA 22209	1 .
Director US Army Materials and Mechanics Research Center ATTN: DRXMR-STL DRXMR-LS Watertown, MA 02172	1 1
Director US Army Ballistic Research Laboratory/ARRADCOM ATTN: DRDAR-TSB-S Aberdeen Proving Ground, MD 21005	2
Director Petrol and Fluid Service Department US Army Quartermaster School Fort Lee, VA 23801	2
Director Naval Research Laboratory ATTN: Code 2627 Washington, DC 20375	1

Addressee	Final Report
Department of the Air Force AFAPL/AFL Wright-Patterson AFB, OH 45433	1
Department of Transportation Library FOB 10A, TAD-494.6 800 Independence Ave., SW Washington, DC 20591	1
Officer-in-Charge (Code 15312A) Naval Construction Battalion Center Port Hueneme, CA 93043	1
Commander US Army Aberdeen Proving Ground ATTN: STEAP-MT-U STEAP-MT-G STEAP-MT-X STEAP-MT-O STEAP-MT-M Aberdeen Proving Ground, MD 21005	1 15 1 1 5
Administrator Defense Technical Information Center ATTN: Document Service Center Cameron Station Alexandria, VA 22314	2

Secondary distribution is controlled by Commander, US Army Test and Evaluation Command, ATTN: DRSTE-D-M.

